

REVO "S" - high-end continous motion bagmaker



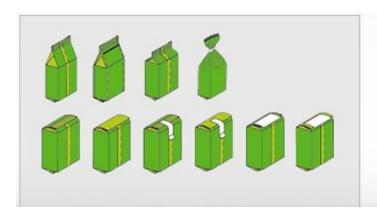

- Can be used for all types of common vffs-bags as well as for special designs
- Low wear & tear sealing systems (heatseal, constant heat or impulse welding, ultra-sonic sealing as option)
- Securely sealed bags because of high mechanical jaw Automatic film tracking pressure (servo-actuated lever drive); opening width and stroke length of crossjaws variable (can be stored under the product code) as well as cross-jaw pressure (pressure setting can also be stored – as option)
- Industrial PC-control (B&R) with colour touch-screen; including 100 product code settings (up to 1000 as option), various operator access levels (password protected), slot for memory card (to safe data), ethernet interface and remote service software (as option)
- All REVO-models can also be equipped with a SIEMENS PLC-control (S7) as alternative
- Intermittant motion mode for the production of high quality block-bottom bags with sealed edges (option)
- Vacuum supported film transport (option)
- Synchronisation with multihead weighers without loss of speed
- No painted parts on the machine; easy to clean and access (full stainless steel option also available)
- Quick film reel changeover by pneumatically actuated splicing table
- Variable body height
- Low wear & tear, highly efficient, quick changeover

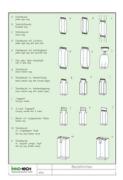

Electrical supply N/PE N/PE N/PE N/PE	Model	2500 REVO \$	3200 REVO S	3800 REVO \$	4500 REVO S
Bag types all* all* all* all* Film types ** ** ** ** max. mechanical speed (cycles/min) 250 200 120 90 Electrical supply 230/400 V - 50 Hz, 3 phases N/PE 6 bar constant pressure, free	Bag width	50-250 mm	80-320 mm	80-380 mm	100-450 mm
Film types ** ** ** ** ** ** ** max. mechanical speed (cycles/min) 250 200 120 90 Electrical supply 230/400 V - 50 Hz, 3 phases N/PE 230/400 V - 50 Hz, 3 phases N/PE 230/400 V - 50 Hz, 3 phases N/PE N/PE N/PE 6 bar constant pressure, free 6 bar	Bag length	350 mm	500 mm	550 mm	600 mm
max. mechanical speed (cycles/min) 250 200 120 90 Electrical supply 230/400 V - 50 Hz, 3 phases N/PE 230/400 V - 50 Hz, 3 phases N/PE 230/400 V - 50 Hz, 3 phases N/PE N/PE 230/400 V - 50 Hz, 3 phases N/PE N/PE 6 bar constant pressure, free	Bag types	all*	all*	all*	all*
Electrical supply 230/400 V - 50 Hz, 3 phases N/PE 6 bar constant pressure, free 6 bar constant pressure, fr	Film types	**	**	**	**
Electrical supply N/PE N/PE N/PE N/PE N/PE N/PE N/PE Obar constant pressure, free 6 bar	max. mechanical speed (cycles/min)	250	200	120	90
	Electrical supply				230/400 V - 50 Hz, 3 phases N/PE
	Pneumatic supply				6 bar constant pressure, free of oil and water